


# Automatic Transmission Pressure Switch Manifolds

## GM Pressure Switch Manifolds


(PSM) are multiple switch assemblies made up of several pressure switches. Fluid pressure is directed to the switches depending on the position of the gear selector and the manual valve. The fluid pressures determine the digital logic at the electrical pins on the PSM which is used by the vehicle's

Powertrain Control Module (PCM) or Transmission Control Module (TCM) to determine what gear range the transmission is operating in.

PSM failures include leaking seals, electrical failure and mechanical failure of the switches. Check for Code 28 (pre OBDII) or P1810 (OBDII).

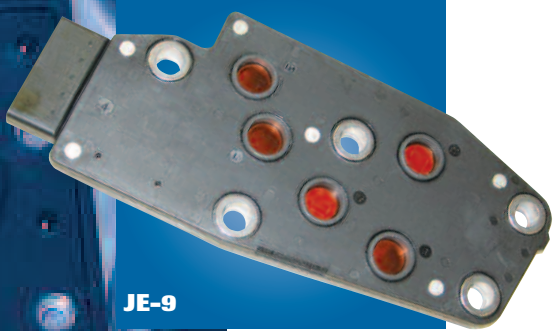

JE-9

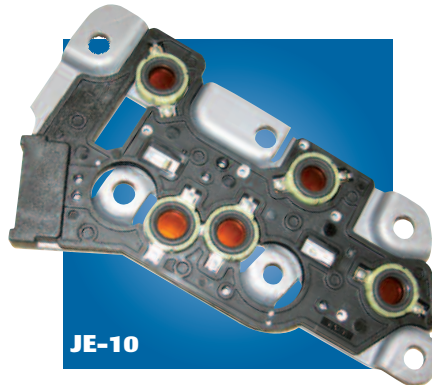

JE-10



JE-11



JE-12



JE-13

**The Value Is In  
The Brand!**

**atp**  
professional auto parts®

5940 W. Oakton Street ■ Morton Grove, IL 60053  
Phone: 1-847-967-6790 ■ Fax: 1-847-967-8686  
[www.atp-inc.com](http://www.atp-inc.com)

**NEW ADDRESS EFFECTIVE MAY 1, 2009**  
1300 Pratt Boulevard ■ Elk Grove Village, IL 60007

## LOCK-UP & SHIFT SOLENOIDS, PRESSURE SWITCH MANIFOLDS, SPEED SENSORS

PART NO.	LIST PRICE	LABOR TIME	APPLICATION	RELATED PARTS	NON OBD II DIAGNOSTIC CODE	OBD II DIAGNOSTIC CODE
CE-1	\$40.40	1.0-2.4 HRS.	GM 4L60E, 700R4	B-96, B-126 FILTER KITS	39	
CE-2	\$35.92	3.5-3.6 HRS.	GM 4L60-E, 4T60-E	B-126, B-161 FILTER KITS	39, 72, 81, 82, 26, 36	P0753, P0756, P0758
CE-3	\$45.20	0.7-1.3 HRS.	GM 4L80-E	JG-107 PAN GASKET REQ.	81, 82, 86, 87	
CE-4	\$39.36	1.1-5.0 HRS.	GM TH125, 200, 200-4R, 325-4L, 440-T4	XG-3, CG-15, B-64, B-68, JG102	39	
FE-2	\$104.25	1.4-2.3 HRS.	FORD AOD-E, AODE-W (2 REQ)	FG-200 GASKET	621, 622	P0750, P0751, P0755, P0756
FE-3	\$49.56	1.4-2.3 HRS.	FORD A4LD	FG-200 GASKET	89	P0740
FE-4	\$57.69	1.4-2.3 HRS.	FORD A4LD	FG-200 GASKET	86	P1733
JE-1	\$36.56	3.5-3.6 HRS.	GM 4T60-E	B-161 FILTER KIT	26	
JE-7	\$74.55	0.7-1.8 HRS.	GM 4L60-E, 4L80-E, 4T80-E	B-126 FILTER, JG-107 GASKET, B-215 FILTER		P0748
JE-8	\$57.65	0.7-1.8 HRS.	GM 4L60-E, 4T65-E, 4T80-E, TH700-R4	B-126, B-161, B-96 FILTER KIT	66	
JE-9	\$55.11	1.3-2.2 HRS.	GM 4L60-E, 4L65-E, 4L70-E	B-126 or B-165 FILTER KITS, SG-30 PAN GASKET	28	P1810, P1811
JE-10	\$39.10	1.3 HRS	GM 4L80-E, 4L85-E	B-105 or B-174 FILTER KITS, JG-107 PAN GASKET	28	P1810, P1811
JE-11	\$51.14	3.5-4.6 HRS.	GM 4T65-E		28	P1810, P1811
JE-12	\$55.11	8.0-10.0 HRS.	GM 4T40-E		28	P1810, P1811
JE-13	\$56.99	1.4-2.1 HRS.	GM 4T80-E		28	P1810, P1811
LE-4	\$61.39	2.6-4.0 HRS.	FORD AX4S	LG-5 GASKET		P1741, P1742, P1743
TE-2	\$55.43	1.2-1.8 HRS.	CHRY. 40RH, 42RE, 42RH, A-518	B-42 FILTER	45	P1740
TE-3	\$45.36	1.1-1.7 HRS.	CHRY. 40RH, 42RE, 42RH, 46RE, 46RH, 47RE, 47RH	B-42 FILTER	37, 45	P1740
TE-4	\$31.30	1.5-1.8 HRS.	CHRY. 30TH, 31TH	B-71	37	P1740
TE-6	\$196.74	1.3-1.4 HRS.	CHRY. A-604	B-102		P0700, P0755
TE-7	\$30.30	0.4-0.5 HRS.	CHRY. A-604	SPEED SENSOR FOR A-604	56	P0715
TE-8	\$33.33	0.4-0.5 HRS.	CHRY. A-604	SPEED SENSOR FOR A-604	57	P0720

## Automatic Transmission Solenoids

